

Locations & Items

The locations and items section of the report summarises the first and last instance of asbestos findings (including materials found to be no asbestos detected [NAD]). Data relating to the first time an item was seen appears in grey italics and data relating to its latest record (most recent instance) is recorded in black non-italicised text with its image appearing in the right hand "latest record" column (the converse applies to first record photos).

It should be borne in mind that this section shows only first and last findings relating to an item and so items that have been for example reinspected over several years will not have reinspection records shown for years intervening first and current.




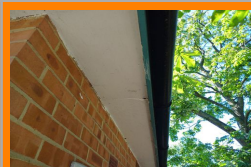
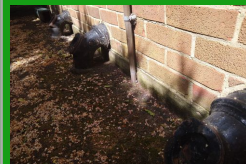
Building: Horniman Museum-Toilet Block				Level: 9	Location: 999/externals		
<i>First Record: Friday, 22nd May, 2020</i>					<i>Latest Record: Thursday, 20th June, 2024</i>		
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	walls	--- brick	-- --	-- --	-- --	-- --	
	window surrounds	--- composite	--- NAD	--- --	--- 25 Lm.	--- Reinspect Periodically	 NAD
	window putty	--- composite	--- NAD	--- --	--- 25 Lm.	--- Reinspect Periodically	 NAD
	fascia	--- wood	--- --	--- --	--- --	--- --	
 R2	soffit	<i>insulating board</i> insulating board	<i>Amosite</i> Amosite	8 8	20 Sqm. 20 Sqm.	<i>Encapsulate</i> Reinspect Periodically	 R2

table continued from previous page...

Building: Horniman Museum-Toilet Block			Level: 9	Location: 999/externals			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	rainwater goods	--- plastic	---	---	---	---	
	mastic to expansion joints	--- modern	---	---	---	---	
	boxing to front of building	--- wood	---	---	---	---	
	void within wood boxing	--- metal pipework	---	---	---	---	
	damp proof course	--- bituminous product	--- NAD	---	30 Lm.	Reinspect Periodically	 NAD

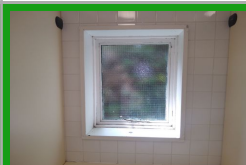
Building: Horniman Museum-Toilet Block			Level: 0	Location: 001/ladies toilet			
				Latest Record: Friday, 22nd May, 2020			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	ceiling	--- plasterboard	---	---	---	---	
	walls	--- ceramic tiles	---	---	---	---	
	floor	--- ceramic tiles	---	---	---	---	
	floor covering	--- modern linoleum	---	---	---	---	
	window surrounds	--- composite	--- NAD	---	10 Lm.	Reinspect Periodically	 NAD
	boxing below sinks and behind toilets	--- wood	---	---	---	---	

table continued from previous page...

Building: Horniman Museum-Toilet Block			Level: 0	Location: 001/ladies toilet			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	void within wood boxing	concrete floor, metal pipework with foam insulation, plastic pipework, plastic toilet cisterns					
	panelling to electrical cupboard	wood					
	doors and frames	wood					
	window frames	metal					



Building: Horniman Museum-Toilet Block			Level: 0	Location: 002/electrical cupboard			
First Record: Friday, 22nd May, 2020				Latest Record: Thursday, 20th June, 2024			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	ceiling	stramit board					
	walls	plaster on masonry and plasterboard					
	floor	concrete					
	floor covering	ceramic tiles					
	electrics	modern					

table continued from previous page...

Building: Horniman Museum-Toilet Block

Level: 0

Location: 002/electrical cupboard

First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
 R3	wrap to incomer cable	bituminous product bituminous product	Presume Chrysotile Presume Chrysotile	3 3	1 Lm. 1 Lm.	Reinspect Periodically Reinspect Periodically	 R3

Building: Horniman Museum-Toilet Block

Level: 0

Location: 003/disabled toilet


							Latest Record: Friday, 22nd May, 2020
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	ceiling	-- plasterboard	-- --	-- --	-- --	-- --	
	walls	-- plaster on masonry	-- --	-- --	-- --	-- --	
	floor	-- ceramic tiles	-- --	-- --	-- --	-- --	
	floor covering	-- modern linoleum	-- --	-- --	-- --	-- --	
	window surround	-- composite	-- NAD	-- --	-- 2 Lm.	-- Reinspect Periodically	 NAD
	boxing behind sink and toilet	-- wood	-- --	-- --	-- --	-- --	
	void within wood boxing	-- concrete floor, wood stud partition and electrical wiring	-- --	-- --	-- --	-- --	
	door and frame	-- wood	-- --	-- --	-- --	-- --	
	window frame	-- metal	-- --	-- --	-- --	-- --	

table continued from previous page...

Building: Horniman Museum-Toilet Block			Level: 0	Location: 003/disabled toilet			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	toilet cistern	ceramic	---	--	--	---	



Building: Horniman Museum-Toilet Block			Level: 0	Location: 004/mens toilet			
				Latest Record: Friday, 22nd May, 2020			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	ceiling	plasterboard	---	--	--	---	
	walls	ceramic tiles	---	--	--	---	
	floor	ceramic tiles	---	--	--	---	
	floor covering	modern linoleum	---	--	--	---	
	window surrounds	composite	NAD	--	8 Lm.	Reinspect Periodically	 NAD
	boxing below sinks and behind toilets	wood	---	--	--	---	
	void within wood boxing	concrete floor, metal pipework with foam insulation, plastic pipework, plastic toilet cisterns	---	--	--	---	
	doors and frames	wood	---	--	--	---	
	window frames	metal	---	--	--	---	
	panelling behind urinals	wood	---	--	--	---	
	void behind urinals	plaster on masonry walls, wood stud frames, metal pipework, plastic toilet cistern	---	--	--	---	

table continued from previous page...

Building: Horniman Museum-Toilet Block			Level: 0	Location: 004/mens toilet			
First Record	Item	Material	Fibre-Type	Score	Extent	Recommend	Latest Record
	window surround within void behind urinals	-- composite	-- NAD	-- --	-- 6 Lm.	-- Reinspect Periodically	<div><div>NAD</div></div>
Building: Horniman Museum-Toilet Block			Level: 0	Location: 005/cupboard accessed through ladies toilet			
<i>First Record: Friday, 22nd May, 2020</i> 🚫 No Access: Unable to gain entry, client unable to provide access				<i>Latest Record: Friday, 14th May, 2021</i> 💬 Cupboard was previously inaccessible, no asbestos observed.			
No Records were taken at this Location							